

Whistling noises from the operational area of the v-ribbed belt

Vehicle manufacturer:	Opel, Vauxhall	A .	
Models:	Corsa C from 2004 Corsa D from 2007 Tigra B from 2004 Agila from 2004 Meriva from 2004 Combo from 2004 Astra-H from 2005		
Engine codes:	C13DT, Z13DT, Z13DTJ, Y13DT, Z13DTH	Image 1: Item replacement	Image 2: Over
Item no.: for DENSO alternator:	535 0151 10	Note: Use the appropriate Schaeffler special tool to replace the over-running alternator	a. 400 0235 10 b. 400 0201 10 c. 400 0200 1

item no.:	
for DENSO alternator:	535 0151 10
for VALEO alternator:	535 0063 10

Diagnosis:

Whistling noises from the operational area of the v-ribbed belt

Possible cause of damage:

The over-running alternator pulley is faulty.

 
Remedy:

With DENSO alternators, depending on the vehicle manufacturer, the original overrunning pulley should be replaced with a modified INA over-running alternator pulley (see image 1).

INA also offers an over-running alternator pulley for vehicles fitted with a VALEO alternator. As there is very little visible difference between the two over-running pulleys, pay close attention to the distinguishing features (see image 3).

Recommendation:

As part of the diagnostic and repair procedure, check the entire control assembly and auxiliary drive system; if necessary, also replace the timing belt and v-ribbed belt as well as the tensioner and deflecting pulleys.





erview of special tools

- 10 (Torx, short)
- 10 (Torx, standard)
- c. 400 0200 10 (Polygon head, standard)
- **d.** 400 0234 10 (Polygon head, short)

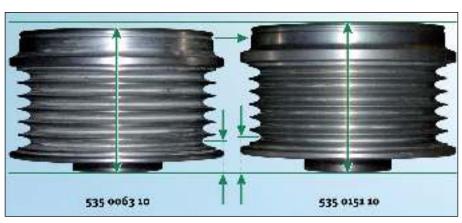


Image 3: Distinguishing between INA over-running alternator pulleys 535 0063 10 (VALEO) and 535 0151 10 (DENSO)

Vehicle manufacturer instructions must be complied with!

Appropriate spare parts can be found in our on-line catalogue at www.Schaeffler-Aftermarket.com or at www.RepXpert.com.

Issued 04.2009 INA 0029

Technical subject to change © 2009 Schaeffler Automotive Aftermarket oHG



For further information:

Phone: +44 (0) 14 32 264 264* 144 (0) 14 32 375 760 Fax: Info@LuK-AS.co.uk www.Schaeffler-Aftermarket.com Calls from within the BK c8157 or not